

Handwritten signature and date: P. Luperon 10/7/13

Handwritten signature: for



**PHYSICAL CARD TEST REPORT
REPORT PRODUCED FOR JOB Q29924
SET 11**

**TO: AMERICO RODRIGUEZ
JUNTA CENTRAL ELECTORAL
AV 27 DE FEBRERO ESQ LUPERON
ZONA INDUSTRIAL DE HERRERA
SANTO DOMINGO, 11113
DOMINICA**

**TEST COMPLETED BY ANDREW VONEIDA September 27, 2013
REPORT COMPLETED BY TERRY SCHINDLER October 7, 2013**

**Q-CARD Laboratories
301 Reagan St.
Sunbury, PA 17801
570-286-7447
www.q-card.com**

Q-CARD completed testing of cards received on August 30, 2013, against an order for nine (9) different tests. The cards were received in new condition. Cards were labeled and identified for each test by Q-CARD. All of the data in this test report pertains to the tests that were ordered.

BLANK WHITE CARDS

Test No. 1

CARD TESTING FOR ID-1 CARD FLEXURE

Per ANSI/INCITS 322:2008, Section 5.4

Card ID#	Axis	Side of Flex Extension	ANSI 440 Class	Credit Card Durability
Card 0110	B	Front Side Up	D2	Fail

PRINTED CARDS - BACK

Test No. 2

CARD TESTING FOR SURFACE ABRASION

Per ANSI/INCITS 322-2008, Section 5.9

Card ID#	Stop Cycles	ANSI 440 CLASS
Card 0110	1250	D5

Test No. 3

CARD TESTING FOR DELAMINATION CROSS HATCH TAPE

Per ANSI/INCITS 322:2008, Section 5.3

Card ID#	Scale Rating	Rating Meaning	
Card 0110	5	No Adhesion	Pass

Test No. 4

CARD TESTING FOR DAYLIGHT EXPOSURE IMAGE STABILITY-XENON ARC

Per ANSI/INCITS 322:2008, Section 5.16

Card ID#	Side Exposed	Observation	Result
Card 0110	Back	No Change	Pass

PRINTED CARDS - FRONT

Test No. 5

CARD TESTING FOR SURFACE ABRASION

Per ANSI/INCITS 322-2008, Section 5.9

Card ID#	Stop Cycles	ANSI 410 CLASS
Card S11P	1250	D5

Test No. 6

CARD TESTING FOR DELAMINATION - 90°

Per ANSI/INCITS 322-2008, Section 5.2

Card ID#	P1	Side Front/Back
	Minimum Peel Force 35N/mm	
Card S11P	Pass	Front

Handwritten signature and date: 2/29/13
RM

Test No. 7

CARD TESTING FOR DELAMINATION CROSS HATCH TAPE

Per ANSI/INCITS 322:2008, Section 5.3

Card ID#	Scale Rating	Rating Meaning	
Card S11P	5	No Adhesion	Pass

Test No. 8

CARD TESTING FOR DAYLIGHT EXPOSURE IMAGE STABILITY-XENON ARC

Per ANSI/INCITS 322:2008, Section 5.16

Card ID#	Side Exposed	Observation	Result
Card S11P	Front	Yellowing	Pass

Test No. 9

CARD TESTING FOR CORNER IMPACT RESISTANCE

Per ANSI/INCITS 322:2008, Section 5.20

Card ID#	CORNER A	CORNER B	CORNER C	CORNER D	Visual Note
Card S11P	N/A	N/A	Fail	Fail	Broke

Executive Summary

Tests that should be reviewed for failure assessment would be mentioned in this summary and all tests that passed 100% of the test requirements are not mentioned here. The test data for each test may be comprehensively reviewed in Annex A of this test report.

Test No. 1, card testing for ID-1 card flexure, indicates that the card body durability class is D2. It is my opinion that the card body should not be used in card usage application that is longer than 2 years.

Test No. 9, card testing for corner impact resistance, indicates that two (2) out of two (2) corners tested have broken corners on corner impact. I think this test supports the brittle card body failure found in test 1.

Thank you for using Q-CARD test laboratory services.

Sincerely,

Terry Schindler
Vice President – Technology Group
Q-Card Laboratories
301 Reagan Street
Sunbury, PA 17801
570-286-7447 or Mobile 570-847-4011
t.schindler@brush-qcard.com
www.q-card.com

[Handwritten signature]
10/20/13

[Handwritten initials]

ANNEX A

PRINTED DATA ARCHIVE

Customer Name: _____

Job #: Q29924-SET11

Card Testing for ID-1 Card Flexure

Sampled By: ADV
 # of Samples Tested: 1
 Technician: ADV
 Time: 7:45 AM
 Date: 9/16/2013
 Temperature: 21.9 C
 Relative Humidity: 48%

Samples Preconditioned:
 Calibration Verified:

Valid Until: 2/14

Card ID#	Axis	Side of Flex Extension	Cycle to Break	Length of Fractures (mm)	Description of Fracture	ANSI A40 Class
Card S11Y	B	Front Side Up	7,200	>24	Pass	D2

Job Notes:

The test results herein relate only to the items tested.
 The test report shall not be reproduced, except in full, without written approval of Q-Card Laboratories.

Customer Name: Junta Cental Electoral

Job #: Q29924-SET11


Card Testing for Surface Abrasion (Backside)

Sampled By: ADV
 # of Samples Tested: 1
 Technician: ADV
 Time: 10:10 AM
 Date: 9/13/2013
 Temperature: 22.3 C
 Relative Humidity: 49%

Calibration Verified: Valid Until: 3/14

Card ID#	Wash Cycles	ANSI A10 CLASS
Card #11P	1250	D5

Job Notes:

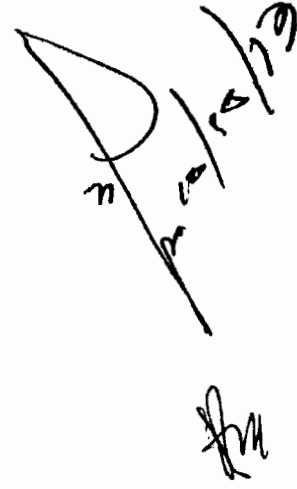
 5/20/2013

Revision 2.0
5/20/2013

1662
JLS

Job #: Q29924-SET11

Customer Name: Junta

Card Testing for Crosshatch Delamination (Backside)

of Samples Tested: 1
Technician: CNJ
Time: 11:30 AM
Date: 9/16/2013
Temperature: 22.9 C
Relative Humidity: 46%

Card ID#	Scale Rating	Rating Meaning
Card 811P	5	No Adhesion Pass

Job Notes:

Job #: Q29924-SET11

Customer Name: Junta Central Electoral

Card Testing for Xenon Arc Test Log (Backside)

Sampled By: ADV
 # of Samples Tested: 1
 Technician: ADV
 Time: 7:50 AM
 Date: 9/24/2013
 Temperature: 22.1 C
 Relative Humidity: 44%

Pre-Test Visual Inspection: Pass
 Post-Test Visual Inspection: Pass

X

Samples Preconditioned

Card ID#	Pre-Test Visual Defects?	Card ID#	Post-Test Visual Defects?
Card S11P	No Defects	Card S11P	No Defects

Job Notes

Card High Resolution Images Pre/Post X
 .96 W/m2 @ 420 nm
 168 Hour exposure time.

Handwritten signature and date: 9/24/13

Job #: Q29924-SET11 Customer Name: Junta Cental Electoral

Card Testing for Surface Abrasion - Front

Sampled By: ADV
of Samples Tested: 1
Technician: ADV
Time: 7:05 AM
Date: 9/12/2013
Temperature: 22.5 C
Relative Humidity: 47%

Calibration Verified: Valid Until: 3/14

Card ID#	Stop Cycles	ANSI #40 CLASS
Card #11P	1250	D5

Job Notes:


Card Testing for Peel Strength (Front)

Card ID#	F1	Min Force Feedback
Card #11P	Minimum Peel Force 36N/mm	1.382
		Front

Sampled By: ADV
 # of Samples Tested: 1
 Technician: ADV
 Time: 12:30 AM
 Date: 9/17/2013
 Temperature: 22.7 C
 Relative Humidity: 44%
 Calibration Verified: Valid Until: 6/14
 Samples Preconditioned:

Job Notes:

Handwritten signature and date: 9/17/13

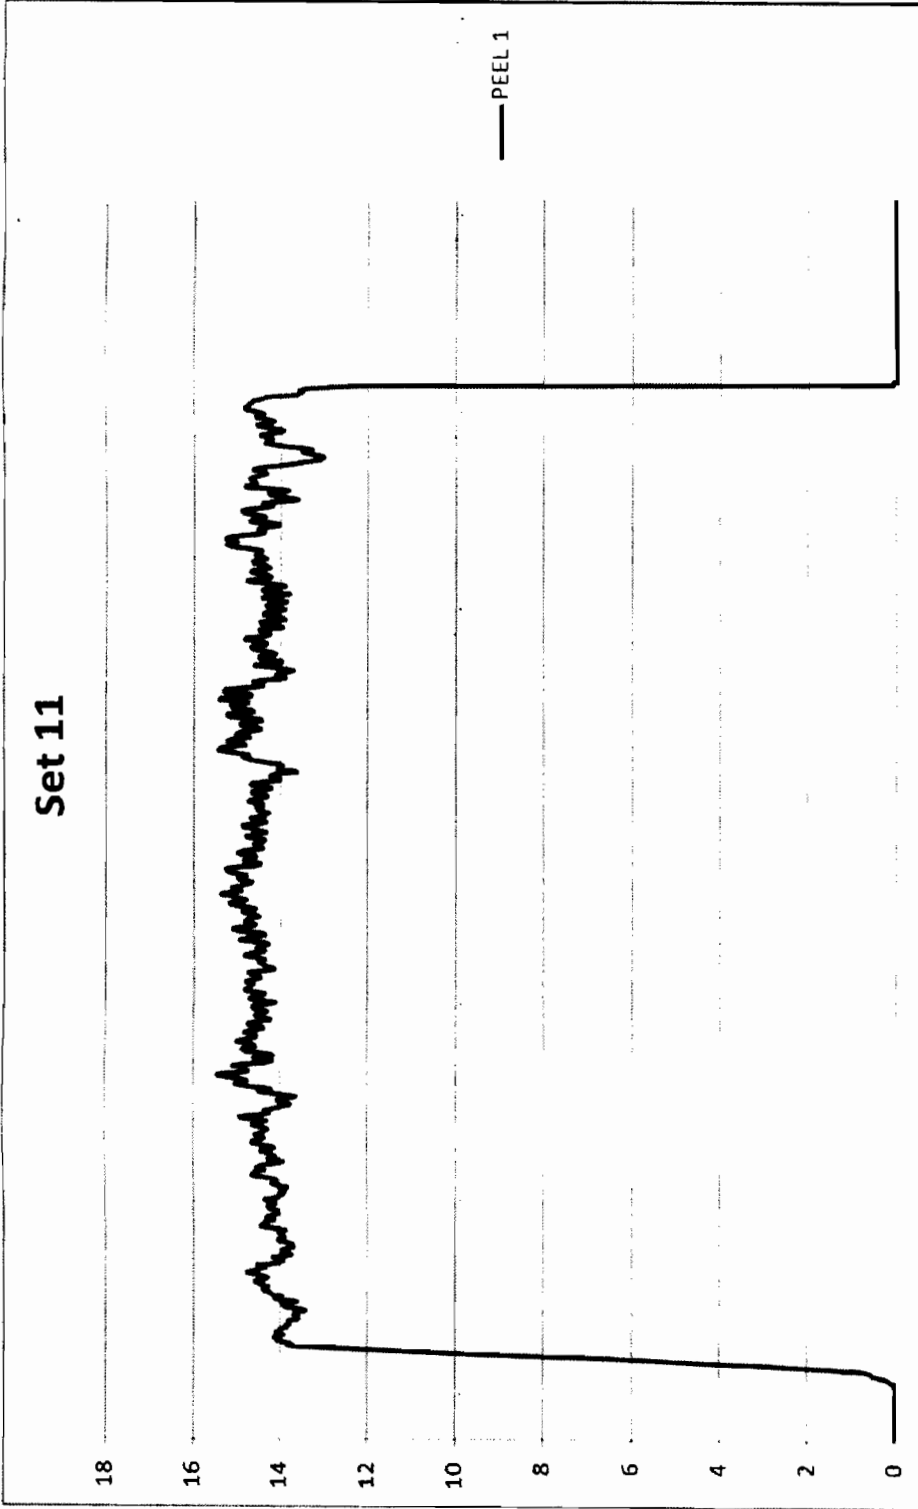

Job #: Q29924-SET11 Customer Name: Junta

Card Testing for Crosshatch Delamination (Front)

Card ID	Scale Rating	Rating Meaning
Card 5/1P	5	No Adhesion Pass

of Samples Tested: 1
Technician: CNJ
Time: 11:30 AM
Date: 9/16/2013
Temperature: 22.9 C
Relative Humidity: 46%

Job Notes:

[Handwritten Signature]
[Handwritten Date: 9/16/13]

Job #: Q29924-SET11

Card Testing for Xenon Arc Test Log (Frontside)

Sampled By: ADV
 # of Samples Tested: 1
 Technician: ADV
 Time: 3:10 PM
 Date: 10/1/2013
 Temperature: 24.7 C
 Relative Humidity: 49%

Pre-Test Visual Inspection:
Pass

Post-Test Visual Inspection:
Pass

X

Samples Preconditioned

Card ID#	Pre-Test Visual Defects?	Card ID#	Post-Test Visual Defects?
Card S11P	No Defects	Card S11P	Yellowing

Job Notes

Card High Resolution Images Pre/Post
 X
 .96 W/m2 @ 420 nm
 168 Hour exposure time.

Job #: Q29924-SET11

Customer Name: Junta Central Electoral

Card Testing for Corner Impact

Corner Impact Test

of Samples Tested: 1
 Technician: ADV
 Time: 10:10 AM
 Date: 10/2/2013
 Temperature: 22.6 C
 Relative Humidity: 50%

Card Sample of Corners



Samples Preconditioned

Card ID#	CORNER A	CORNER B	CORNER C	CORNER D	Visual Note
Card S11P	N/A	N/A	Fail	Fail	Broke

Job Notes:

[Handwritten signature]
 10/2/13

END PAGE